

SP006	
Standard Operating Procedure	
Sampling Procedures (SP)	
Static Water Level Determination	
Geotech Tuff Tape Depth Sounder	
Marshall K. Cheung, Ph.D., Laboratory Director	
Marshall K. Cheung, Ph.D., Laboratory Director	
Anne Cheung, Laboratory Manager	
Marshall K. Cheung, Ph.D., Laboratory Director	

# Table of Contents

1.	Scope and Application	.5
2.	Summary of Method	.5
3.	Comments	.5
4.	Apparatus	.5
5.	Reagents	.5
6.	Procedure	.5
7.	Maintenance	.6
8.	Bibliography	.6



29 Palms Laboratory 47-250 Dillon Road Coachella, Ca 92236 Phone: 760-398-0050 Fax: 760-398-0028

Title:	Static W	ater Level Determination
Number	:	SP006
Release	Date:	3/6/01
Revision	n Date:	02-05-02
Version:		1.2



<b>Document</b> No.:	SP 0006- 1.2 - 006	
Copy provided to:	29 Palms Band of Mission Indians	
Title:	<i>Title</i> : Tribal Council	
Address:	46-200 Harrison Place	
	Coachella, CA 92236	
Copy provided by:	Jan Kilduff, Ph.D.	
Title:	Laboratory QA Officer	
<i>Date:</i> July 27, 2004		



29 Palms Laboratory 47-250 Dillon Road Coachella, Ca 92236 Phone: 760-398-0050 Fax: 760-398-0028

Title:	Static Water L	evel Determination
Number:		SP006
Release	Date:	3/6/01
Revisio	n Date:	02-05-02
Version:		1.2



# 1. Scope and Application

- 1.1. This standard operating procedure describes the process that will govern the collection of static water level data prior to each field-sampling event using the Tuff Tape depth sounder.
- 1.2. Information gathered will contribute to the overall understanding of the aquifer system and support groundwater monitoring project design with historical water level data.

### 2. Summary of Method

- 2.1. Check battery of depth sounder by listening for buzzer and watching for light when instrument is turned on.
- 2.2. Rinse depth sounder with distilled water and wipe dry.
- 2.3. Lower depth sounder probe into well casing until buzzer and light activate.
- 2.4. Adjust sensitivity of sounder.
- 2.5. Take measurement off tape at top of well casing in feet.
- 2.6. Subtract the height of the casing above the ground.
- 2.7. Record static water level in bound logbook (Surface Water Monitoring Logbook #21A or Groundwater Monitoring Logbook #13A).
- 2.8. Rinse probe and store.

# 3. Comments

- 3.1. This procedure can be followed to determine draw down during well purging and sampling.
- 3.2. To monitor draw down, use depth sounder to continuously determine water level during the time that the pump rate is varied.
- 3.3. When the water level remains constant with the pump at a set rate, the pump rate equals the rate of groundwater recharge.

# 4. Apparatus

- 4.1. Geotech Tuff Tape Water Level Measuring Device (depth sounder)
- 4.2. Keck Tape Guard
- 4.3. Tape measure

# 5. Reagents

5.1. Distilled Water

# 6. Procedure

- 6.1. Check battery on sounder by turning **On/Sensitivity** knob clockwise (listen for tone and look for red LED light).
  - 6.1.1. If battery is low, the light will be dim and the tone faint.
  - 6.1.2. Replace 9-volt battery by lifting and removing black panel on faceplate.
- 6.2. Rinse with distilled water and dry with Kimwipe.
- 6.3. Lower depth sounder probe into well slowly until buzzer and light activate.
- 6.4. Turn On/Sensitivity knob counter-clockwise until buzzer and light shut off.
  - 6.4.1. This sensitivity adjustment causes the sounder to be activated only by contact with the water column instead of by condensation within the well casing above the water column.



29 Palms Laboratory 47-250 Dillon Road Coachella, Ca 92236 Phone: 760-398-0050 Fax: 760-398-0028

- 6.5. Without moving the tape, turn the sensitivity dial clockwise to exactly the position where the light and buzzer activate.
- 6.6. Take measurement off tape at top of well casing in feet.
- 6.7. Determine height of well casing above ground in feet with tape measure.
- 6.8. Calculate depth to water (static water level) using the following equation:6.8.1. Depth (ft)= Measurement off tape (ft) casing above ground (ft)
- 6.9. Record static water level in Groundwater Monitoring Logbook #13A, following the Field Record Template for Groundwater Sampling.
- 6.10. Remove tape from well and rinse with distilled water.
- 6.11. Dry tape completely and store with the sounder turned off.

### 7. Maintenance

- 7.1. The tape on the Tuff Tape depth sounder can be cleaned Liquinox if necessary.
- 7.2. The sounder itself and reel can be cleaned with a water-dampened cloth if necessary.
- 7.3. The probe at the end of the tape can be cleaned with Liquinox and a soft brush to remove silt or mud if necessary.
- 7.4. If the depth sounder will be stored for more than 6 months between uses, the 9-volt battery should be removed.

### 8. Bibliography

- 8.1. Fisher WLT Water-Level Indicator Operating Manual. Fisher Research Laboratory, 200 W. Willmott Road, Los Banos, CA 93635.
- 8.2. Geotech Tuff Tape Water Level Measuring Device Instruction Manual (11/00).